



All dimensions must be checked on site and not scaled from this drawing.

Revisions

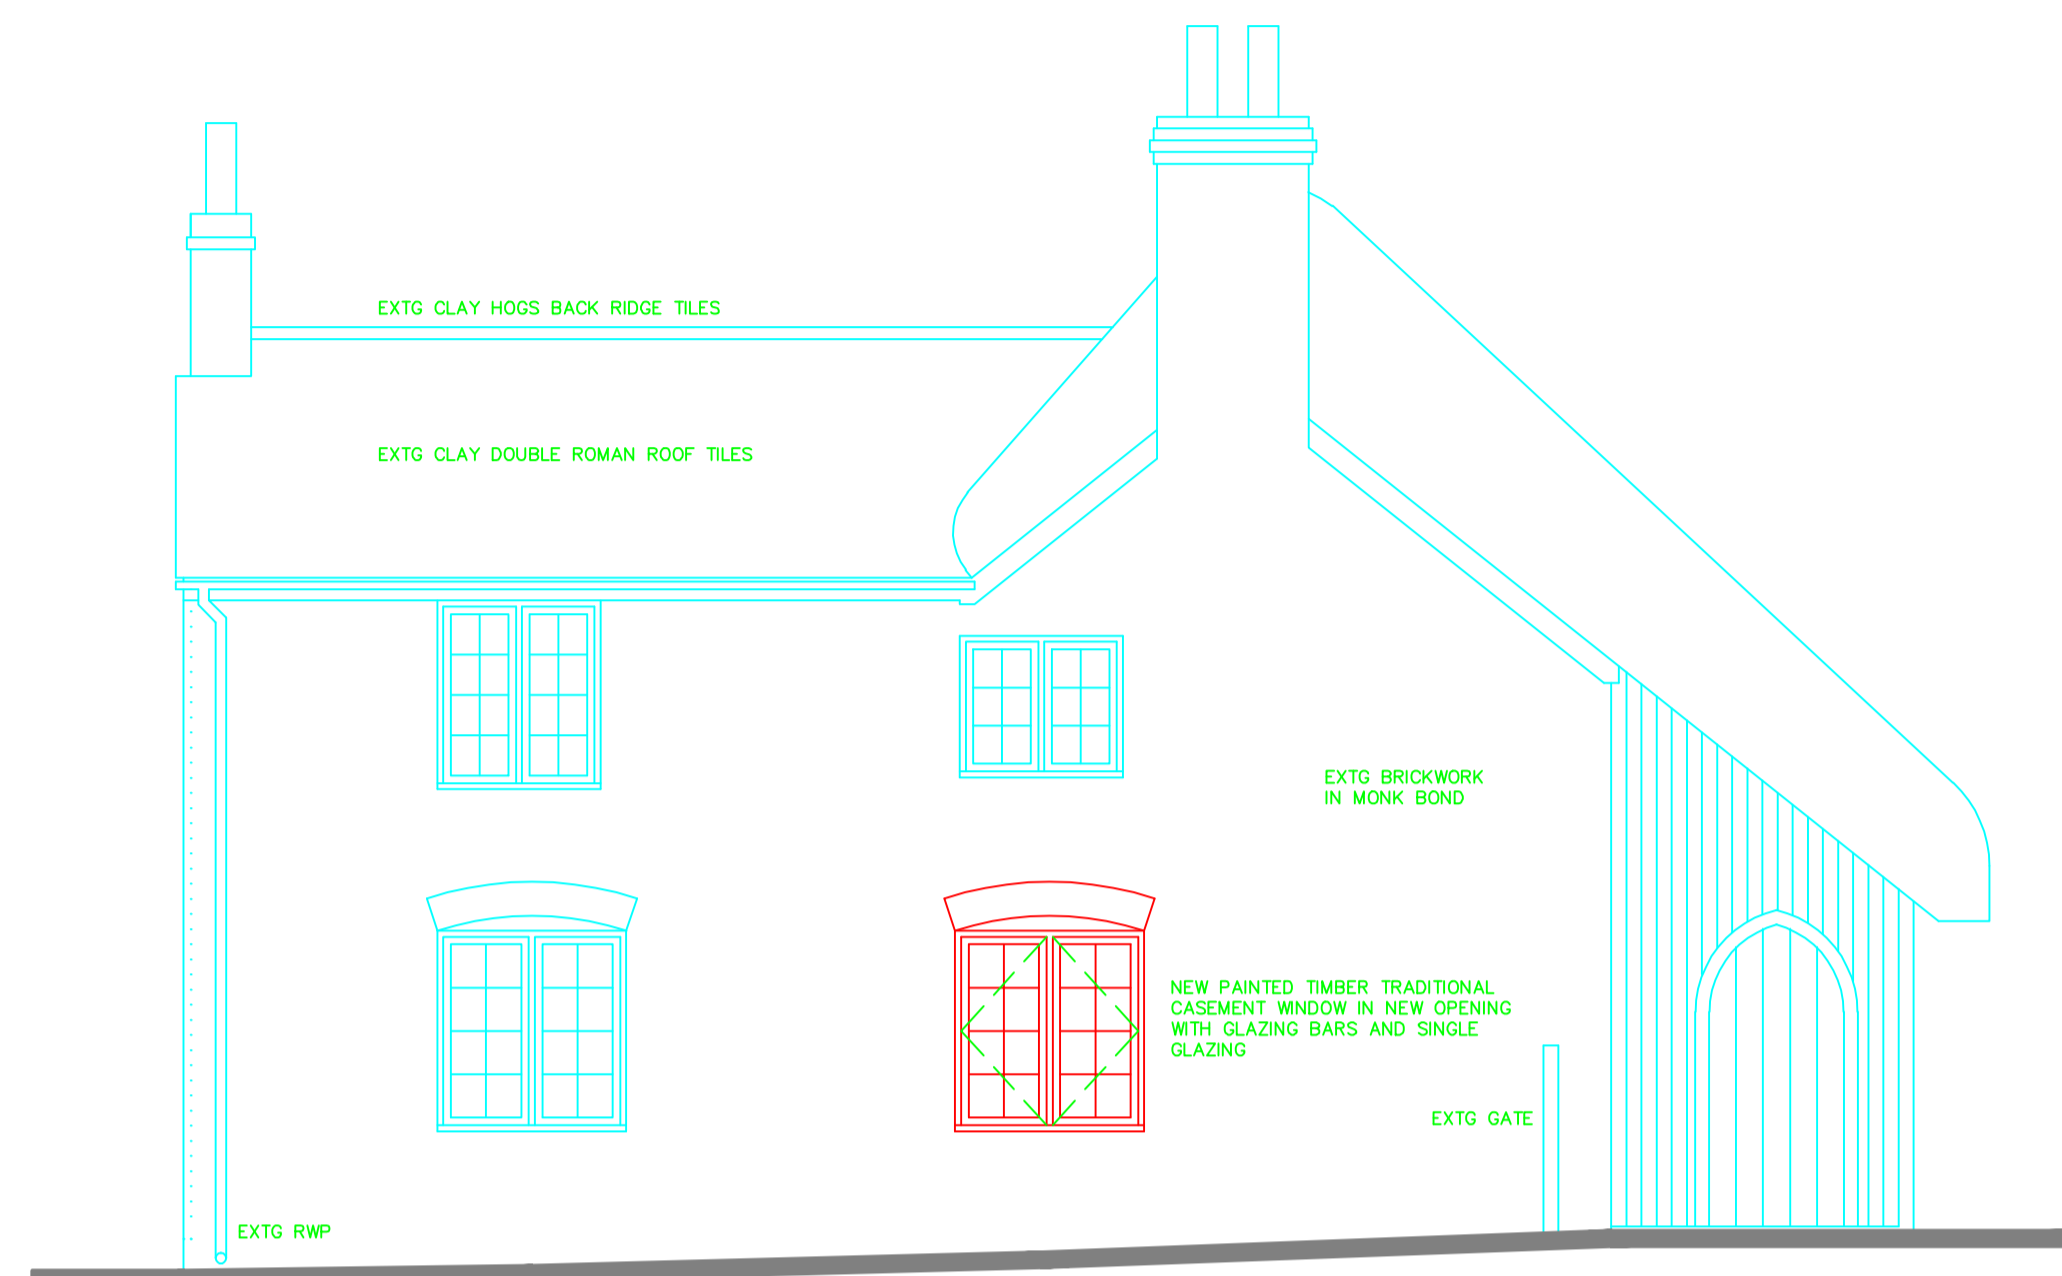


ANY DEFECTIVE BRICKWORK TO SOUTH-EAST (SIDE) ELEVATION TO BE CUT OUT AND REPLACED WITH BRICKWORK BEDDED AND POINTED IN LIME MORTAR. BRICKWORK REPOINTED IN LIME MORTAR WHERE REQUIRED AND BRICKWORK DECORATED WITH NEW LIME WASH TO SELECTED COLOUR MIXED AND APPLIED IN ACCORDANCE WITH MANUFACTURERS RECOMMENDATIONS.

SOUTH-EAST (SIDE) ELEVATION

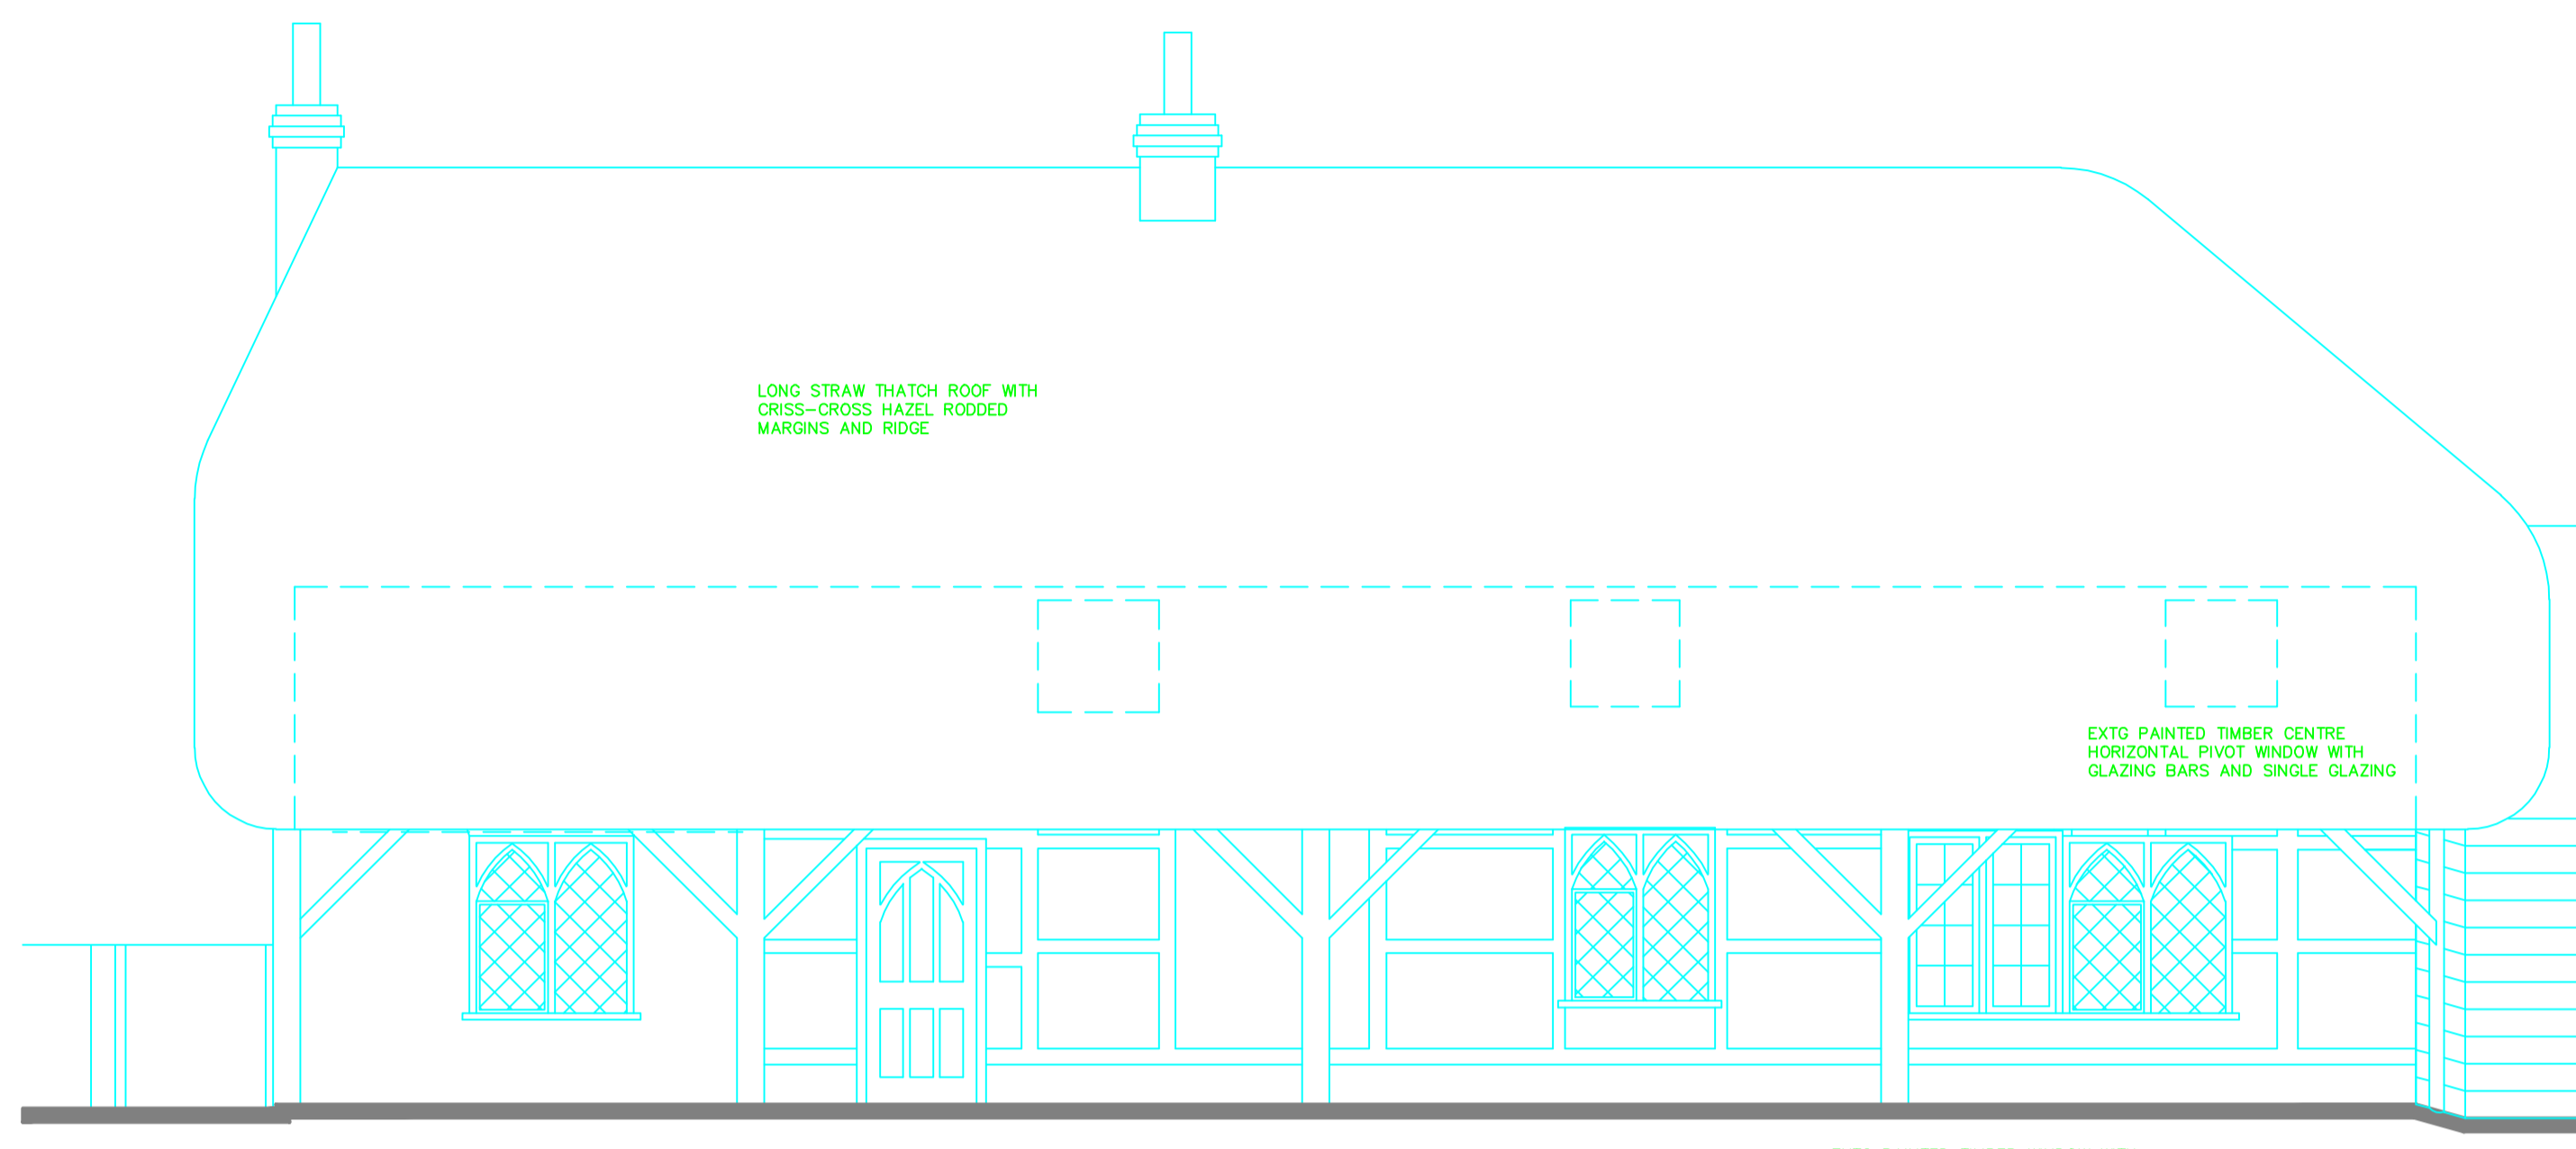

NORTH-EAST (FRONT) ELEVATION

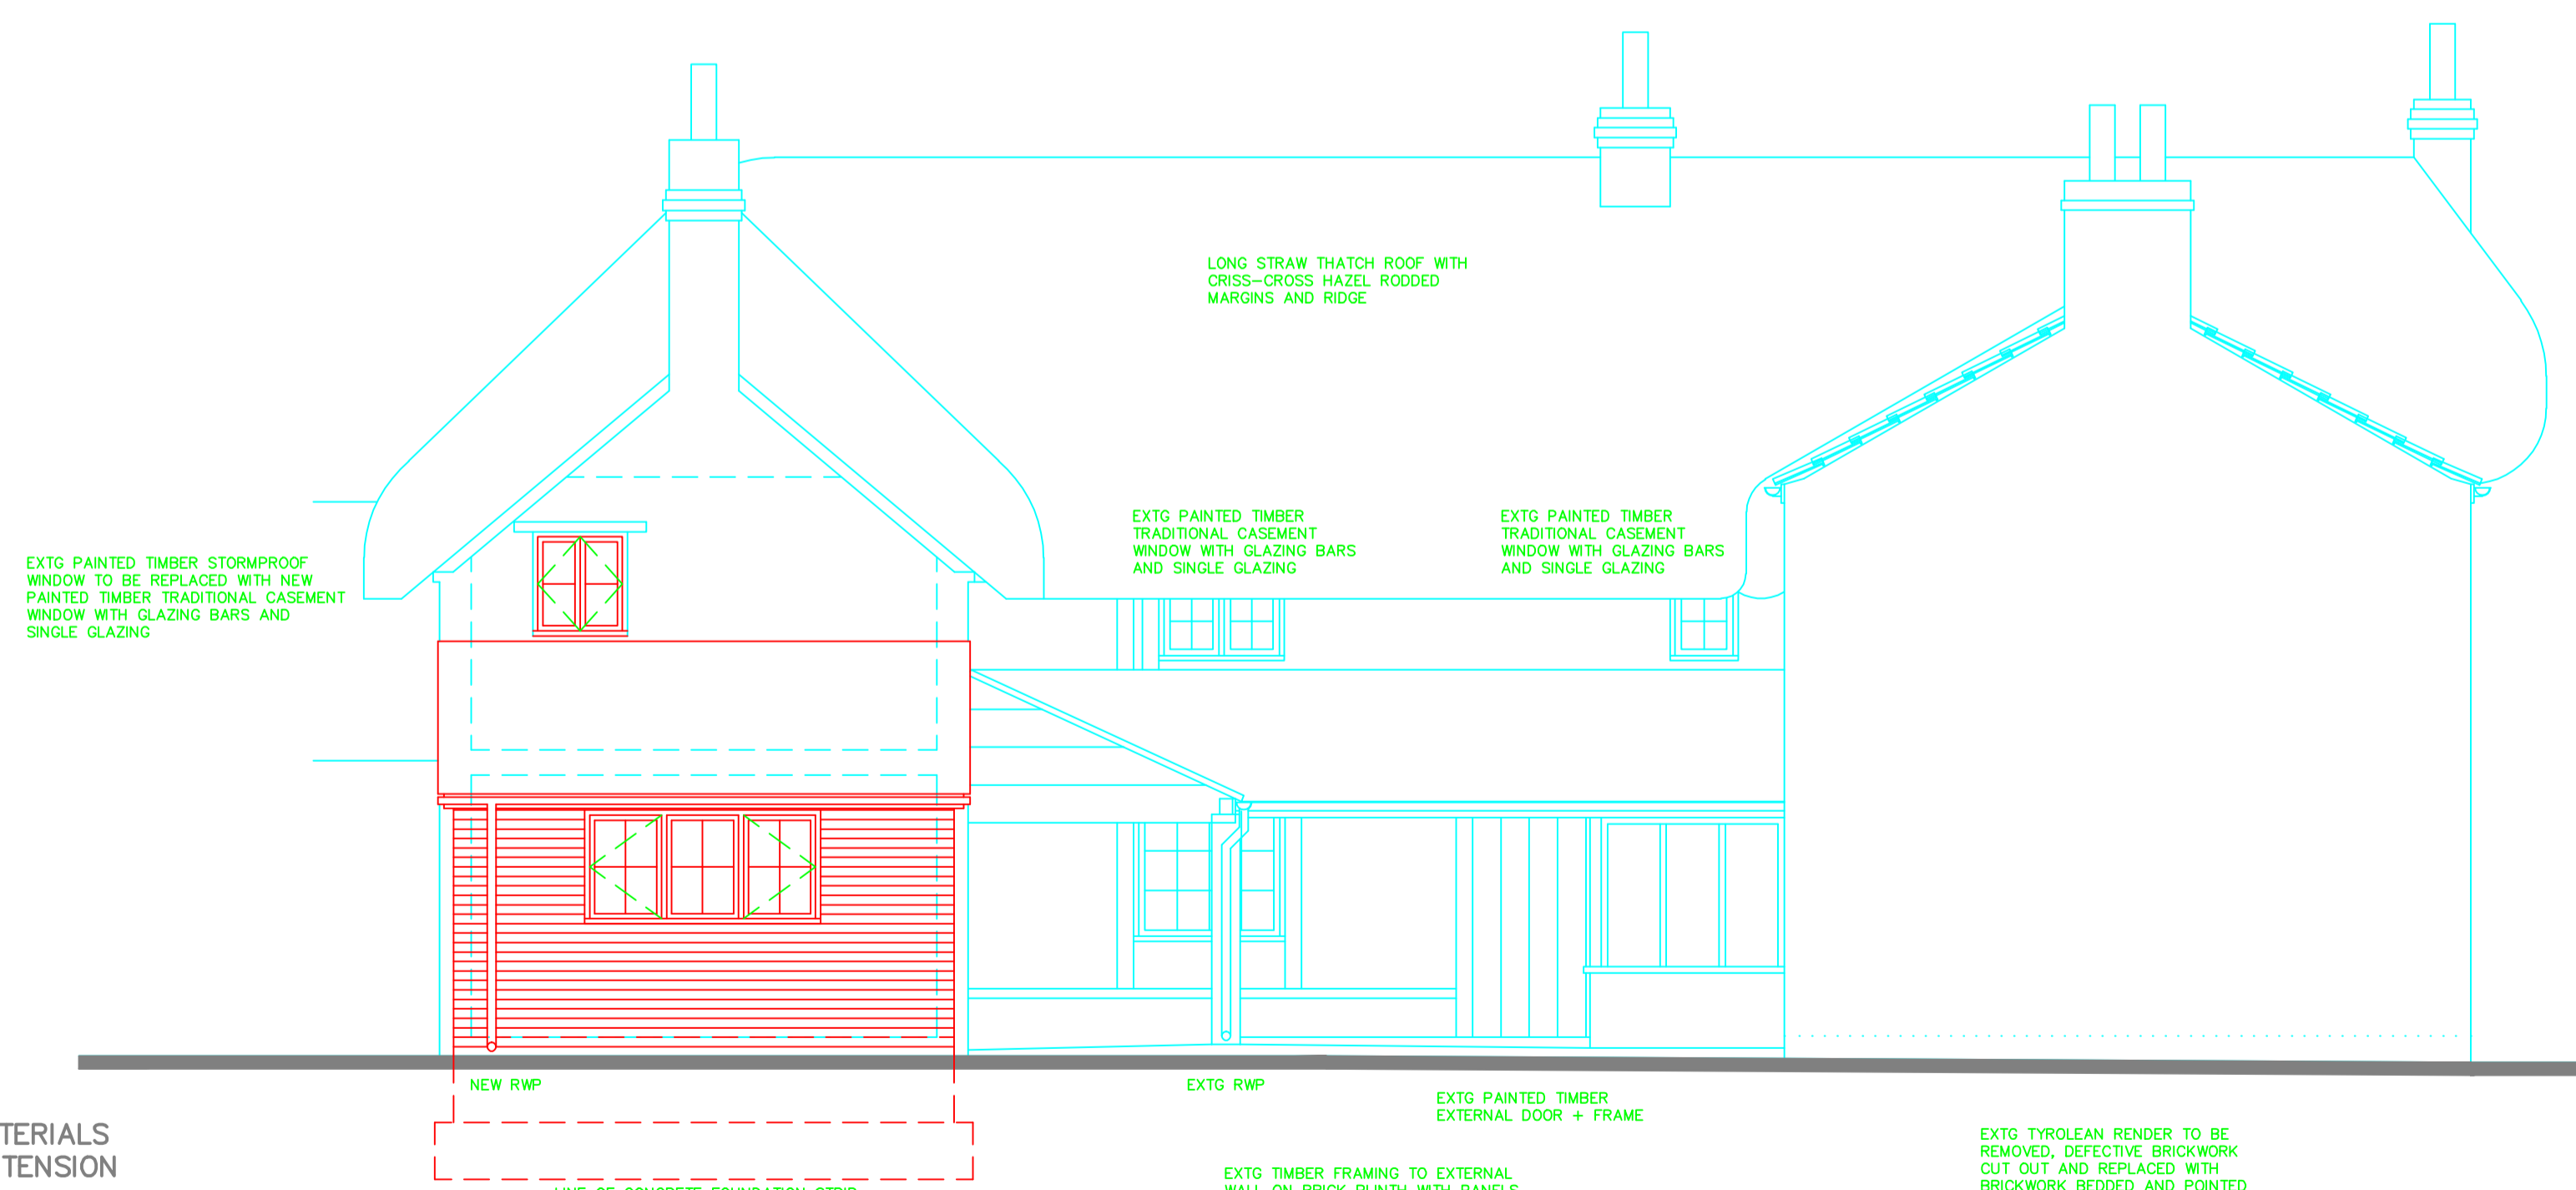

PROPOSED EXTERNAL MATERIALS TO LEAN-TO KITCHEN EXTENSION

FACING BRICKWORK TO EXTERNAL WALLS USING BRICKWORK SALVAGED FROM DEMOLITION OF EXTG OUTBUILDINGS Laid FLEMISH BOND WITH BRICKWORK BEDDED AND POINTED IN LIME MORTAR AND BRICKWORK DECORATED IN LIME WASH TO SELECTED COLOUR MIXED AND APPLIED IN ACCORDANCE WITH MANUFACTURERS RECOMMENDATIONS.

PAINTED TIMBER ROOF JOINERY.

ROOF COVERING TO BE CLAY SINGLE PANITLES USING TILES SALVAGED FROM DEMOLITION OF EXTG OUTBUILDINGS.

CAST IRON RAINWATER GOODS PAINTED 'BLACK'.

CEILING TO EXTENSION AT UNDERSIDE OF ROOF RAFTERS WITH EXTG BRICKWORK TO EXTG UPPER GABLE EXTERNAL WALL REMAINING VISIBLE FROM INSIDE EXTENSION.

SOUTH-WEST (REAR) ELEVATION

NEW PAINTED TIMBER TRADITIONAL CASEMENT WINDOW WITH GLAZING BARS AND SINGLE GLAZING

EXTG BRICKWORK GABLE EXTERNAL WALL WITH IRREGULAR BONDING, PART MONK BOND TO BASE WITH UPPER WALL IN STRETCHER BOND ABOVE SOLDIER HEADER COURSE.

EXTG TYMBOLEAN RENDER TO BE REMOVED, DEFECTIVE BRICKWORK CUT OUT AND REPLACED WITH BRICKWORK BEDDED AND POINTED IN LIME MORTAR. BRICKWORK REPOINTED IN LIME MORTAR WHERE REQUIRED AND BRICKWORK DECORATED WITH NEW LIME WASH TO SELECTED COLOUR MIXED AND APPLIED IN ACCORDANCE WITH MANUFACTURERS RECOMMENDATIONS.

EXTG TYMBOLEAN RENDER TO BE REMOVED, DEFECTIVE BRICKWORK CUT OUT AND REPLACED WITH BRICKWORK BEDDED AND POINTED IN LIME MORTAR. BRICKWORK REPOINTED IN LIME MORTAR WHERE REQUIRED AND BRICKWORK DECORATED WITH NEW LIME WASH TO SELECTED COLOUR MIXED AND APPLIED IN ACCORDANCE WITH MANUFACTURERS RECOMMENDATIONS.

EXTG TYMBOLEAN RENDER TO BE REMOVED, DEFECTIVE BRICKWORK CUT OUT AND REPLACED WITH BRICKWORK BEDDED AND POINTED IN LIME MORTAR. BRICKWORK REPOINTED IN LIME MORTAR WHERE REQUIRED AND BRICKWORK DECORATED WITH NEW LIME WASH TO SELECTED COLOUR MIXED AND APPLIED IN ACCORDANCE WITH MANUFACTURERS RECOMMENDATIONS.

Client
MR + MRS FIELDING.

Project
PROPOSED ALTERATIONS AND EXTENSIONS, MARSH FARM HOUSE, SEEND ROAD, WORTON, DEVIZES, WILTSHIRE. SN10 1SG

Drawing Title
WORKING DRAWING. ELEVATIONS. SHEET 1.

Scale 1/50	Date MAR 2009	Drawn by
---------------	------------------	----------

Tim Weeding Building Design Services
30 Mill Road
Worton
Devizes
Wiltshire SN10 5SP
Telephone & Fax :
(01380) 726903

Project Number 2007-25	Drawing Number 22
---------------------------	----------------------